

SERVICE BULLETIN



No. : 0IVL20060062

Date : 2006-06-17

| | | | | | | | | |
|----------------|---|---------------|----------------------------|------------|------------|-------------------------------|--------|-----------|
| Model | Factory | Factory Model | Suffix | Model No. | Factory | Factory Model | Suffix | Model No. |
| | EKHQ | 32LC2D-UD | ALUSLL | 32LC2D | ENMX | 32LC2D-UD | ALCALL | 32LC2D |
| | ENMX | 32LC2D-UD | ALUSLL | 32LC2D | EKHQ | 37LC2D-UD | ALUSLL | 37LC2D |
| | ENMX | 37LC2D-UD | ALCALL | 37LC2D | ENMX | 37LC2D-UD | ALUSLL | 37LC2D |
| | EKHQ | 42LC2D-UD | APUSLL | 42LC2D | ENMX | 42LC2D-UD | ACCLLB | 42LC2D |
| | ENMX | 42LC2D-UD | ALCALL | 42LC2D | ENMX | 42LC2D-UD | ALUSLL | 42LC2D |
| | ENMX | 42LC2D-UD | APUSLL | 42LC2D | | | | |
| Buyer | Buyer Name | Buyer Code | Buyer Name | Buyer Code | Buyer Name | Buyer Code | | |
| | LGEUS | US000001 | LGEAI | US000002 | | | | |
| EFFECTIVE DATE | 2006-06-16 | | EFFECTIVE FROM(SERIAL NO.) | | | 603XXXXXXXXXX ~ 604XXXXXXXXXX | | |
| Subject | No Video/Audio Fix for 2006 LCDs: 32LC2D-UD, 37LC2D-UD, 42LC2D-UD | | | | | | | |

| No. | Loc No. | Before Change | | After Change | | Note | K-Code | Remark |
|-----|---------|---------------|-------------|--------------|-------------|------|--------|--------|
| | | Part No | DESC./SPEC. | Part No | DESC./SPEC. | | | |

Reason Of Change

Problem TVs:
2006 LCD, PDP, & MDPs that use the ARM CPU & Macronix Flash Memory.

Symptom:
During a specific date range the customer may turn on the TV and there will be no video or audio. The problem will first occur: Jun 20th, 2006, 14:03 ~ Jun 21st, 08:14. Then it repeats every 194 days.

Solution:
Temporary fix is a hard reset (unplug for 3 minutes). New firmware is available as a permanent fix. The update needs to be done by a service center.

Models (USA):
32LC2D, 37LC2D, 42LC2D, 42PC3DV, 42PC3DVA, 42PC3D, 50PC3D, 50PX2D, 50PX2DC made between March 1, 2006 and April 30, 2006.

Serial Numbers:
603XXXXXXXXXX ~ 604XXXXXXXXXX
603 = March, 2006
604 = April, 2006

Tools Required:
Computer
Null Modem Serial Cable

Tools Supplied:
Instructions
Firmware Files
DTVLab Update Software

Versions:
32LC2D-UD : Ver3.06.1
37LC2D-UD : Ver3.06.1
42LC2D-UD : Ver3.05.1
42PC3DV-UD(42PC3DVA-UD) : Ver3.06.1
42PC3D-UD : Ver3.07.1
50PC3D-UD : Ver3.07.1
50PX2D-UD(50PX2DC-UD) : Ver3.10.1

Be sure to check the software version before any update is attempted, some units already have the latest software.

DTVLab.exe
Download files.zip
Pacific_060619_Service_Bulletin[1].pdf
LCD_PDP_2006.pdf

** FILE THIS SERVICE BULLETIN WITH YOUR SERVICE MANUAL

| NOTE(**) : INTERCHANGEABILITY CODE | | | KEY-WORD CODE |
|------------------------------------|------------------|--|---|
| | Parts Set | | |
| A | Original → Early | Original or new parts may be used in early or late production sets. Use original parts until exhausted, then stock new parts. | 1. To improve performance 2. To improve productivity |
| | New → Late | | |
| B | Original → Early | Original parts may be used in early production sets only. New parts may be used in early or late production sets. Use original parts where possible, then stock new parts. | 3. To improve reliability 4. Change of material or dimension |
| | New → Late | | |
| C | Original → Early | New parts only may be used in early or late production sets. Stock new parts. | 5. Addition 6. Deletion |
| | New → Late | | |
| D | Original → Early | Original parts only may be used in early production sets. New parts may be used in late production sets only. Stock original and new parts. | 7. Correction |
| | New → Late | | |

CHIEF ENGINEER , *approved*
Factory.